

M17/M18 PQDR

Background –

- [REDACTED] is having a new issue with our SIG M18's
- The Safety Lock as pictured is shearing and disabling the Drop Safety.
- Weapon will still fire and function normally but can be unsafe if dropped.
- If not corrected weapon could accidentally discharge.



Ongoing Actions –

- Inspected and repaired as required.
- [REDACTED]
- The affected part can only be replaced as an entire assy: Striker Assy [REDACTED]
- Request that armorers keep Striker Assemblies on hand as Shop Stock.
- 3 x of the 115 on hand were found broken during inspection.
- Round count on the affected pistols was approx. 5-6000 rounds.

Recommendations –

- Adjacent Unit Armorers one time inspect all weapons of the affected area on the underside of the slide
 - Reinspect every time the weapon is issued.
- [REDACTED]


Side by Side Comparison



Normal

Missing


Good Striker Assembly

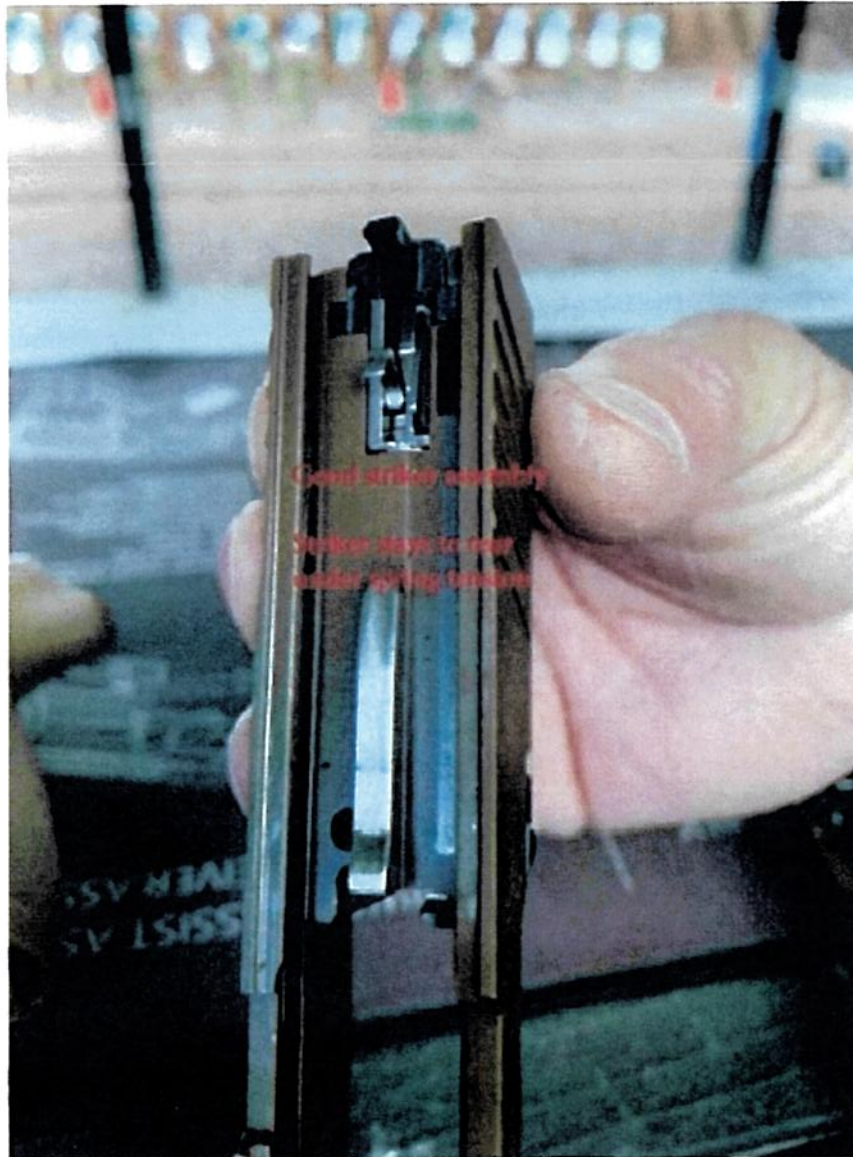


Bad Striker Assembly



Striker Assembly Removed

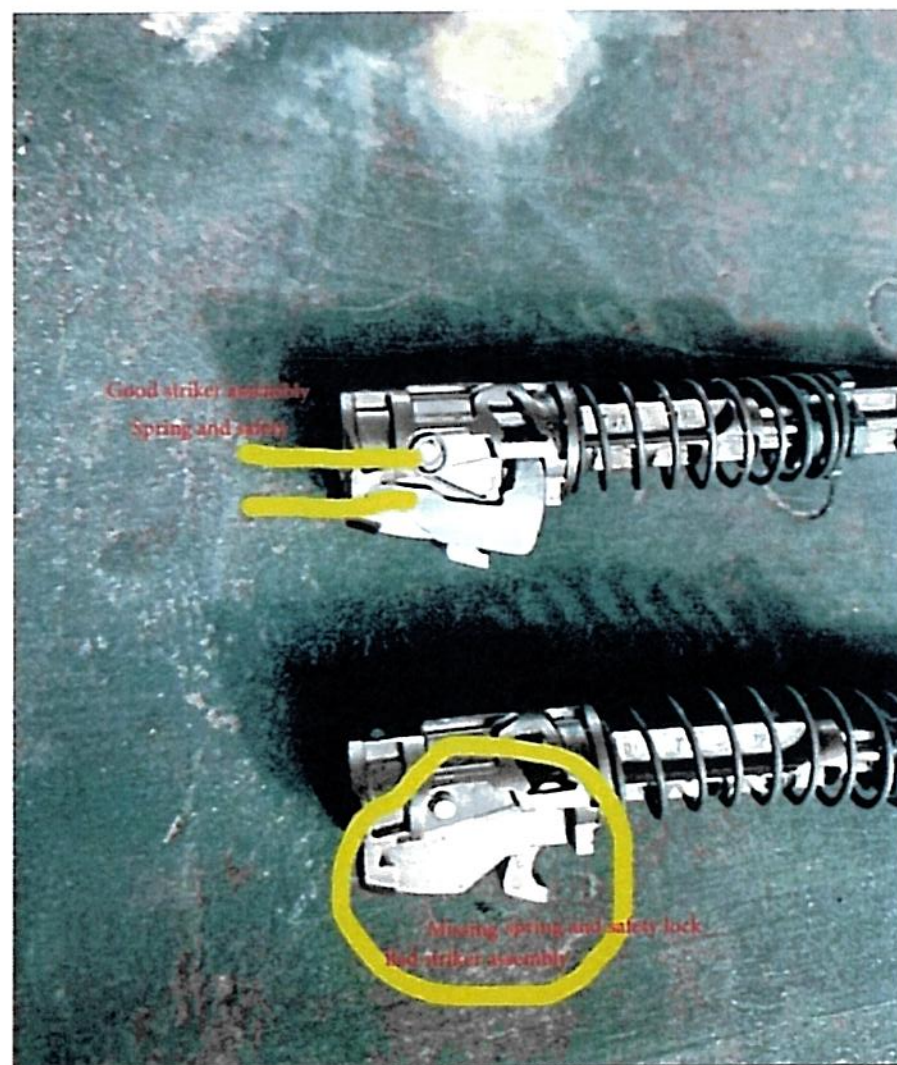

Striker Pin Forward

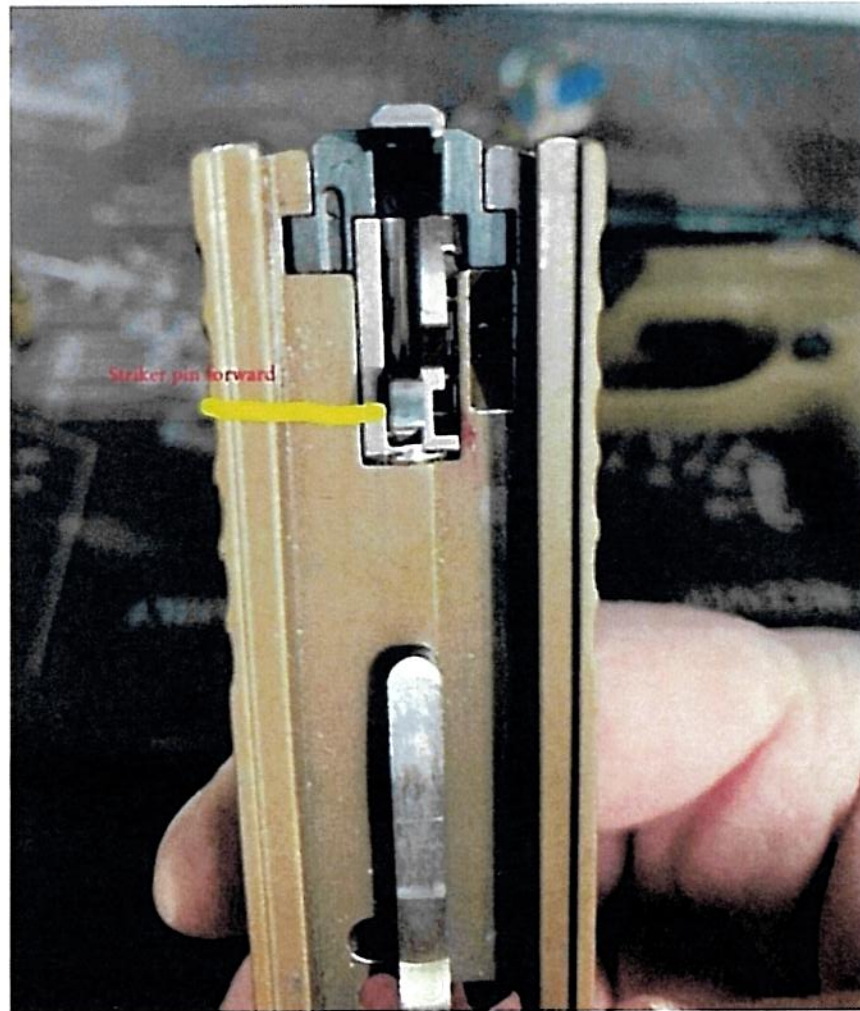

Striker Pin Full View

